

Volume Driver V5.0 Release Notes for OpenStack Cinder Liberty Release

September 2016



violin
MEMORY

Table of Contents

Introduction 1

Supported Operations..... 1

RedHat Certification..... 3

Violin Memory Customer Support 4

Legal Notice..... 4

Introduction

These release notes provide information about supported operations and known issues for the Volume Driver V5.0.0 for the OpenStack Cinder Liberty Release. For instructions on installing and configuring the Volume Driver V5.0.0, see the *Volume Driver V5.0 Installation and Configuration Guide for OpenStack Cinder Liberty Release*.

The OpenStack Cinder driver package from Violin Memory adds block-storage service support for Violin 7000 Series Flash Storage Platforms (FSPs) and 7700 FSP controllers. The package is implemented as a storage 'plug-in' using the standard Cinder storage driver API, and facilitates the creation, attachment and management of volumes (LUNs) between a 7000 Series FSP and different host servers.

All Cinder volume features required for the OpenStack Liberty release are supported, including volume, snapshot and clone operations. The 5.0.0 driver package release can be used with any OpenStack Liberty deployment for all 7000 Series FSPs and 7700 FSP Controllers running Concerto 7.6.0 or above.

Supported Operations

7000 Series FSPs and 7700 FSP Controllers support the following operations:

- Create volume
The types of volumes (LUNs) that can be created are dedup, thick and thin. The LUN type is specified using cinder volume-type along with explicit extra-specs (that identify the LUN type). For more information on these extra specifications, see the *Volume Driver V5.0 Installation and Configuration Guide for OpenStack Cinder Liberty Release*.
- Delete volume
- Attach volume
- Detach volume
- Create snapshot
- Delete snapshot
- Create cloned volume
- Initialize Connection (attach a volume to an instance)
- Terminate connection (detach a volume from an instance)
- Create volume from snapshot
- Create volume from image
- Extend volume
- Get volume statistics

Known Issues

The following table lists known issues and for some scenarios, an action to take to resolve the issue.

Table Legend: The ✓ symbol denotes issues that have a workaround.

Bug	Description
✓ 28403	<p>When creating a new volume from an existing volume, the size of the new volume remains the same as the existing volume.</p> <p>Workaround: The Violin Cinder driver does not accept a new size parameter for the new volume. Therefore, when creating a new volume from an existing volume, do not attempt to alter the size. If you require the size of the new volume to be larger than the old volume, wait for the new volume to be created and the content copied, then extend the LUN size.</p>
✓ 28480	<p>Extending the LUN size of a dedup LUN will render the LUN unusable.</p> <p>Workaround: Once a dedup LUN is created, its size cannot be altered. Doing so may leave the LUN unusable, and will have to be deleted.</p>
28489	<p>Cannot create a new volume from an existing volume if the existing volume is not of type thick.</p> <p>The volume type is inherited from the source, and a new volume type is not allowed to be specified for a volume created from another volume. The current release of the Violin Cinder driver only allows you to create a new volume from an existing volume if the existing volume is a thick LUN.</p>
✓ 28731	<p>LUNs created outside of OpenStack and exported to the client running OpenStack might cause I/O disruptions on OpenStack-created LUNs during a Memory Gateway HA failover.</p> <p>Workaround: Do not assign any LUNs to the client outside of OpenStack, directly from the array or through Symphony. If you must do so, as part of initial setup, un-assign the LUNs from the client and remove the LUNs before bringing up OpenStack Cinder on the client.</p>
✓ 30213	<p>When creating an instance from a large snapshot of a volume, the operation occasionally fails. The reason is that Nova times out prematurely without allowing the copy to complete.</p> <p>Workaround: To circumvent this issue, add the following settings to <code>nova.conf</code>:</p> <pre>block_device_allocate_retries = 600 block_device_allocate_retries_interval = 3 block_device_creation_timeout = 60</pre>
✓ 31246	<p>After migrating volumes from one storage pool to another storage pool, <code>/dev/mapper</code> still shows some of the maps to be in use. This is seen only if the migration happens while the volume is attached to the instance.</p> <p>Workaround: Delete the residual maps using the following command</p> <pre>dmsetup remove -f /dev/mapper/<mpath></pre>

RedHat Certification

Violin Memory Cinder Driver 5.0 is certified against RedHat OpenStack Platform 8.

The following is the configuration of the system used. This configuration is provided here as a reference only, with no specific requirement of the client server or the OS running on it as a prerequisite to use Violin Cinder Driver 5.0.

Server: Supermicro
Model Number:
Manufacturer: Supermicro
Product Name: X8DTH
Version: 1234567890

OS: RedHat 7.2
OpenStack: RHEL OpenStack Platform 8
HBAs: Qlogic 8G FC (QLogic QLE2562 - PCI-Express Dual Channel 8Gb Fibre Channel HBA)
Driver Version: 8.07.00.18.07.2-k
Firmware Version: 7.03.00

Driver: OpenStack Cinder Driver V5.0 (Liberty)
FC Switch: Brocade switch 300
Switch firmware version: v6.4.3d

Violin Array: 7300 FC
Aria Version: 7.1.2.0
Concerto version: 7.6.0

Violin Memory Customer Support

Violin Memory, Inc. USA

4555 Great America Parkway

Santa Clara, CA 95054

<http://www.violin-memory.com/support/>

E-mail: support@vmem.com

Legal Notice

Copyright© 2010-2016 Violin Memory, Inc. All rights reserved.

Violin, Violin Memory and the Violin logo are registered trademarks of Violin. A complete list of Violin's trademarks and registered trademarks is available at www.violin-memory.com/company/trademarks/

All other brands, product names, company names, trademarks, and service marks are the properties of their respective owners.

Licenses of Violin's software are subject to the terms and conditions set forth in Violin's End User License Agreement. Sales of Violin's hardware are subject to Violin's Terms and Conditions applicable to sales of hardware.

Violin Memory, Inc.
4555 Great America Parkway
Santa Clara, CA 95054
USA